



Shenzhen ORT Technical Services Co., Ltd.

校验码 (Check code) :

GT7RLO



scan to verify

TEST REPORT

Report Number ORT260612112701-R01					
Sample Name:	DVR-MIR010、 DVR-MIR010-BO		Applicant:	WATEX CO.,LTD.	
Model:	WTX-M08-10		Address:	162-13, Godo-cho, Ota-city, Gunma, Japan 373-0004	
Spec:	/		Vendor or Supplier:	/	
Brand:	/		Address:	/	
Sample Quantity:	1 PC		Manufacturer:	/	
Specimen Source:	Submitted by applicant		Address:	/	
Received Date:	Jun. 14, 2026	Detection Date:	Jun. 15, 2026	Report Date:	Jun. 15, 2026
Test Standard:	According to ECE R46 6.1.3.2.				
Test Item:	Impact Test				
Test Requirements:	Please refer to the test record on the next page.				
Tested By:	Meng WenLong	Date:	Shenzhen ORT Technical Services Co., Ltd. Jun. 15, 2026		
Signature:	Meng Wen long	Jun. 15, 2026			
Checked By:	Lonny Chen	Date:			
Signature:	Lonny Chen	Jun. 15, 2026			
Approved By:	Makoto Wu	Date:			
Signature:	Makoto. Wu	Jun. 15, 2026			
Note:	/				

I Testing Overview

1 Sample Information

Name	Model	Quantity	Sample No.
DVR-MIR010、 DVR-MIR010-BO	WTX-M08-10	1 PC	ORT260612112701-SS1/1

Note: Except for Section I "Sample Information" which uses full sample numbers, sample numbers in other chapters of this report are presented in abbreviated form.

2 Summary of Test Results

No.	Test Record	Test Item	Sample No.	Sample Test Results	Test Conclusion
1	Page 3	Impact Test	SS1/1	1 Frontal Impact:The streaming media mirror is intact, but the stand is broken. 2 45° angle Impact:The streaming media mirror is in good condition.	PASS

Note: (1) "PASS" means Conformity Rule, "FAIL" means Nonconformity Rule, and "N/A" means Not Applicable.

(2) For further details,please refer to the following page(s).



II Test Records

1 Test Item : Impact Test

1.1 Test Equipment:

No.	Equipment Name	Model No.	Equipment No.	Calibration Validity
1	Pendulum impact testing machine	15L	ORT-BCCJ-01	2026.06.18

1.2 Lab Environment: Temperature: 24.4 °C; Relative humidity: 44 %.

1.3 Test Condition:

1.3.1 Frontal Impact: The ball head hits the reflective surface.

1.3.2 45° angle Impact: The reflective surface of the lens should form an angle of 45° with the original motion direction of the point on the sphere of the collision point, the collision direction should be towards the reflective surface, and the collision point should be the horizontal plane of the center of the lens reflective surface of the protective cover of the lens, which should pass through the edge.


1.5 Acceptance Criteria:

1.5.1 After frontal impact test,the remaining protruding part was not more than 10mm, and the radius of curvature of the surrounding parts is more than 2.5mm.


1.5.2 After 45 ° angle impact test, the remaining protruding part was not more than 10 mm,and the radius of curvature of the surrounding parts is more than 2.5 mm.

III Test photo:


Pre-test :

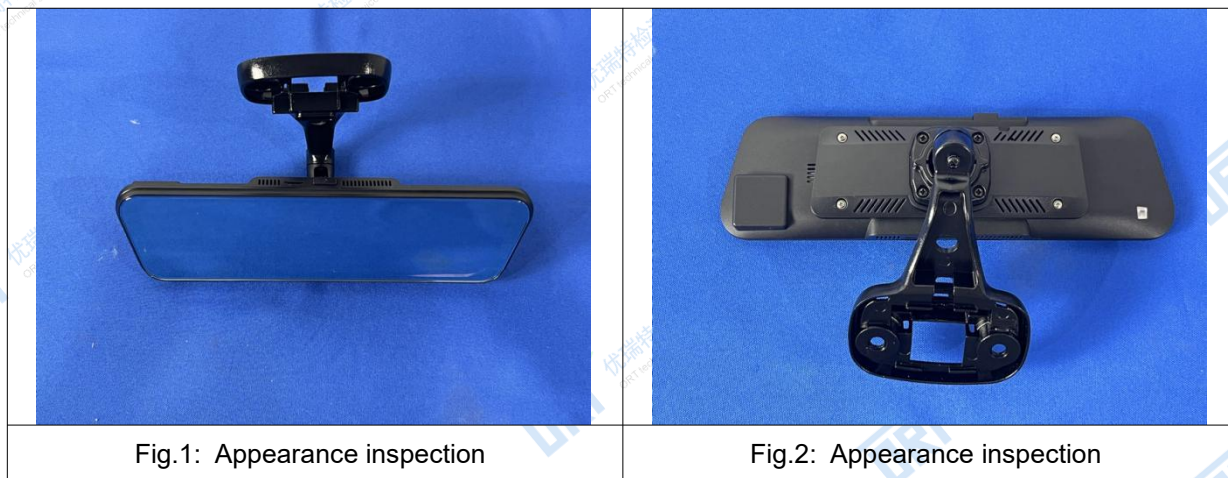

Test Item 1: Impact Test

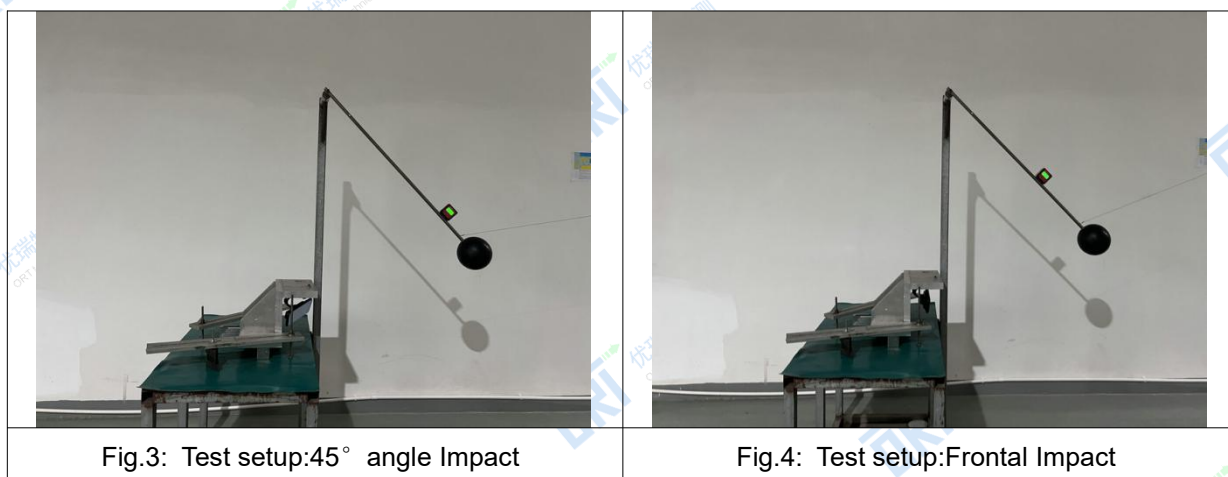

Post-test:

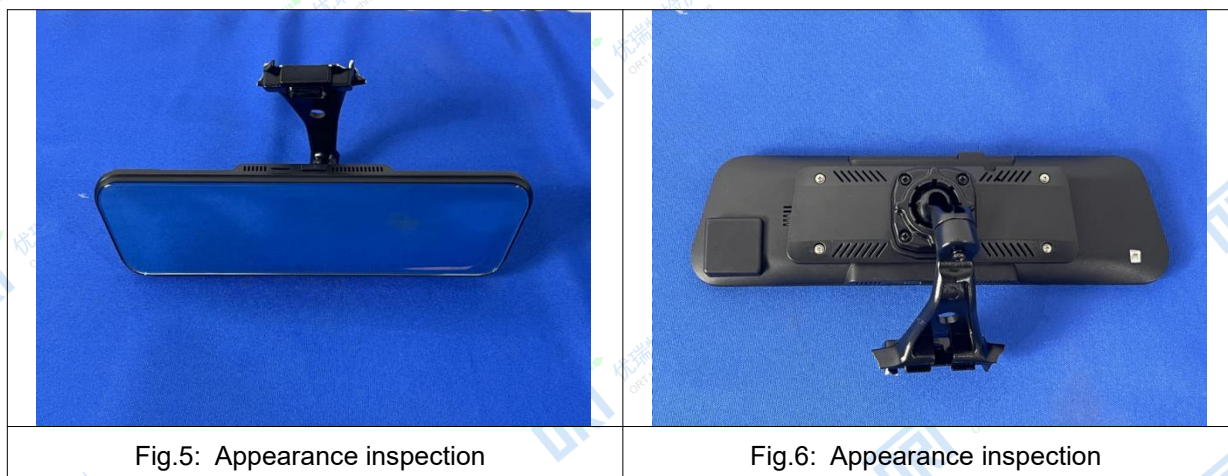

*** End of Report ***

Declaration

- (1) The test results of this test report are only responsible for the tested samples.
- (2) The test report is invalid without the Special Seal for Inspection and Testing and authorized signature.
- (3) The report shall not be partially copied without the written permission of ORT Testing.
- (4) Test items with '*' in the report are subcontracted inspection items.
- (5) Test items that have not obtained qualification recognition are only used for scientific research, teaching, or internal quality control. If the client has any objection to the test results, an appeal shall be submitted to our laboratory within 15 days after receiving the report; any overdue application will not be considered.

Shenzhen ORT technical services Co., Ltd.

Site Location: 101, 102, Block 1C, Caili Industrial Park, 228 Industrial Zone, Silian Community, Henggang Street, Longgang District, Shenzhen

Web: <http://www.ort-ts.com>

Tel: +86-755-27817553

Fax: +86-755-27817553

Email: service@ort-ts.com

